

Transport, installation, commissioning

TNL12.2

Note on applicability

Illustrations in this publication may deviate from the product supplied. Errors and omissions due to technical progress expected.

A word on copyright

This document is protected by copyright and was originally compiled in German.

The duplication and distribution of this document or parts thereof is prohibited without prior consent of the copyright owner, and any violators will be prosecuted. All rights, including the right to translate, are reserved.

© Copyright by INDEX-Werke GmbH & Co. KG

Symbols	7
Safety	8
Installation plan	9
Installation plan TNL12.2, simplified	9
Installation items - load distribution TNL12.2	10
General	11
Information for transporting the machine	11
Lifting device	11
Space requirements	12
Floor condition	12
Fastening/anchoring	12
Ambient conditions	13
Floor trough	13
Compressed-air supply	13
Operating material to be provided	13
Pumps and tanks	13
Connection to local extraction system by customer	13
Power supply	14
Main circuit breaker	14
External data transfer	14
Chip removal	15
Disposal of used operating materials	15
Observing the ground and wastewater regulations	15
Transporting the machine	17
Delivery of the machine	17
Dimensions and weights	18
Machine TNL12.2	18
Cooling lubricant unit	18
Machine center of gravity (S)	19
Transport by crane (min. 3 t capacity)	20
Attaching the lifting device components	21
Attaching the machine to the lifting device	22
Remove the transport supports/transport lugs and wooden planks	23
Transporting with a forklift	25
Technical requirements – forklift	25
Remove the transport supports/transport lugs and wooden planks	27

Transport with transport rollers	28
Technical requirements – transport rollers	29
Remove transport supports/transport lugs and wooden planks	29
Positioning the hydraulic jacks	30
Placing the machine on transport rollers	31
Installing the machine	33
Place the machine on the installation items.	33
Indicator lamp	33
Electrical connection	33
Important notes	33
Removing the transport locks from the machine	34
Locations of the transport locks on the machine	34
Leveling the machine	39
Fastening/anchoring to the floor	40
Connecting the machine to central extraction unit	42
Shutoff damper for fire protection	42
Installing configuration levels and additional equipment	45
Transporting and installing the cooling lubricant unit	45
Installing the cooling lubricant unit	46
Sealing of cooling lubricant unit / machine	47
Connecting the cooling lubricant system	48
Pneumatic connection	49
Provision of compressed air	49
Air consumption	49
Commissioning	51
Cleaning the machine	51
Check the working media levels and replenish, if necessary	52
Data loss due to prolonged downtime	52
Switching on the machine	53

Relocation of the machine	55
Preparing the machine for transport	55
Transport locks on the machine	55
Locations of the axes for attaching the transport locks	55
Drain the hydraulic tank before transport	56
Seal disconnected hose lines or pipelines	56
Corrosion protection	56
Transporting the machine by truck	57
Machine preparation for transport by truck	57
Transporting the machine by truck	58
Approved straps (a)	58
Loading guard	59

Symbols

Explanation of the symbols used in the user documentation.



This symbol warns against a direct, imminent danger to the life and health of individuals. Failure to observe this danger warning may result in severe health impairment, such as perilous injury and even death.



This symbol warns against a direct, imminent danger from electricity. Failure to observe this danger warning may result in severe health impairment, such as perilous injury and even death.



This symbol indicates important notes for the proper operation of the machine.
Failure to observe this caution may cause malfunctions on the machine.
This can result in damage to entire assemblies or parts thereof.



Reference to other documents.

Safety

Safety Instructions and Technical Specifications



The user documentation, in particular, the document "Safety Instructions and Technical Specifications" must be observed.



Operating mode key switch position 2 (special operating mode)

Activation of special functions (key cannot be removed)







The key may only be placed in position 2 (special operating mode) by authorized persons, and the machine may not be left unattended. After finishing **or** interrupting the activity in this operating mode, the key must be immediately returned to position 1 or 0 and removed. The responsibility lies with the operator/owner.

Installation plan TNL12.2, simplified



The corresponding installation and layout plan must be requested before the machine is installed.


Example shown

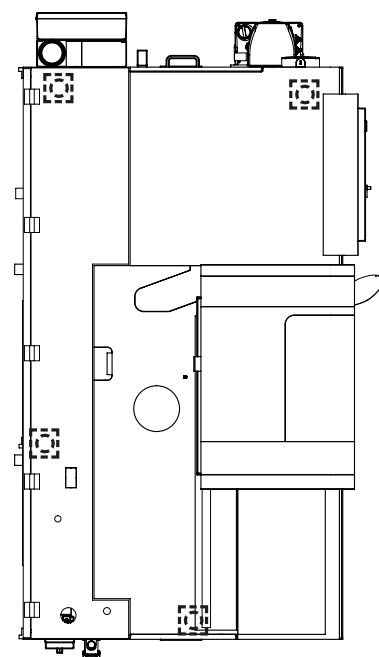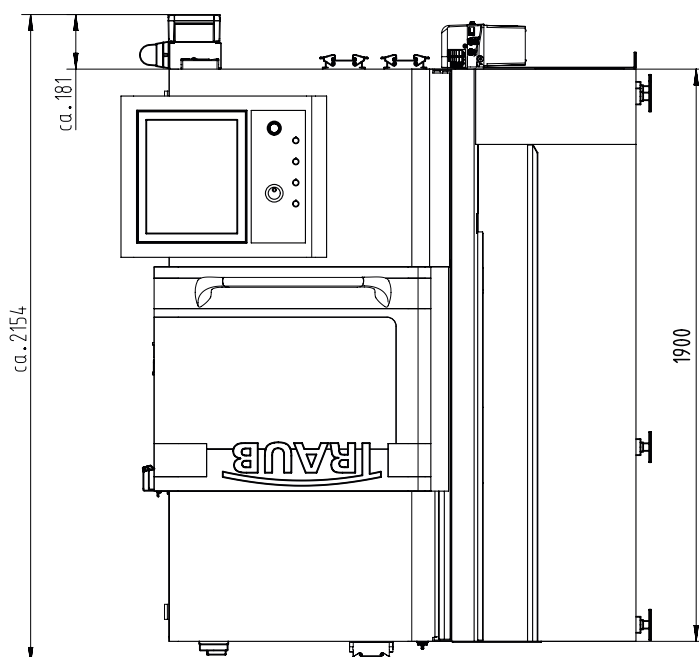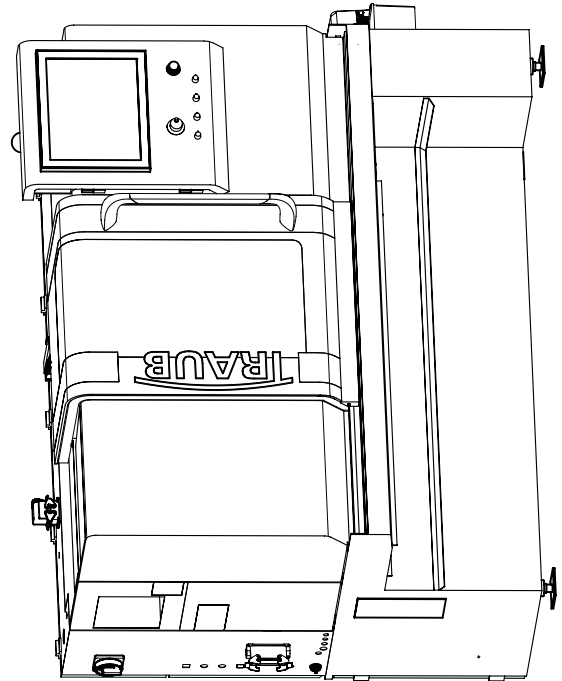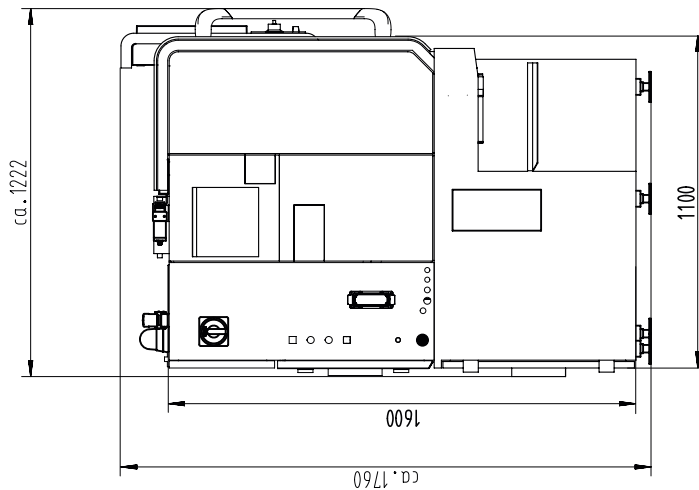

10011216412

Installation items - load distribution TNL12.2

Installation items	A	B	C	D
Max. static load (kN)	5.0	9.7	3.5	6.9

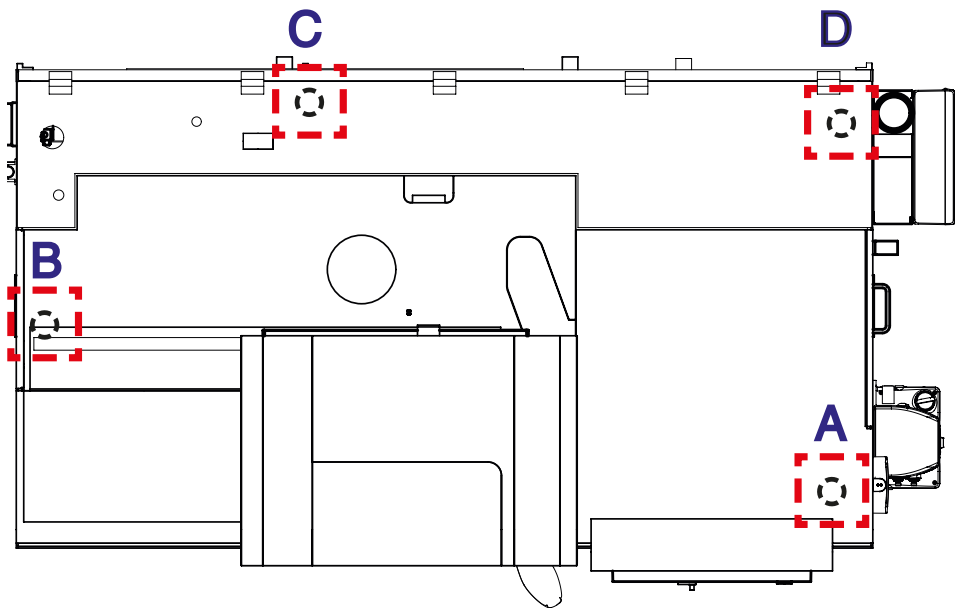

Information for transporting the machine



Danger from falling machine/parts

Keep away from under suspended loads.



Transporting the machine

Approved means for transporting the machine:

- Crane (requires lifting device)
- Transport rollers
- Forklift



Shipping of the machines to countries with extreme climatic conditions is carried out by specialized logistics companies.

Be sure to carefully plan the delivery, unloading, and transporting of the machine from the unloading site to the installation site.

Take the size (dimensions) and weight of each unit into consideration.

Any obstacles along the transport route from the unloading site to the installation site must be eliminated before the machine is delivered.

Check the transport route for load-carrying capacity, levelness, damaged pavement, traverse grooves, slopes, gradients, etc.

Lifting device


Lifting devices are either packed separately or included with other units.



The lifting device required for proper transport of the machine is supplied with the machine and must be returned to INDEX after the machine has been installed.



The lifting device must not be disassembled further.

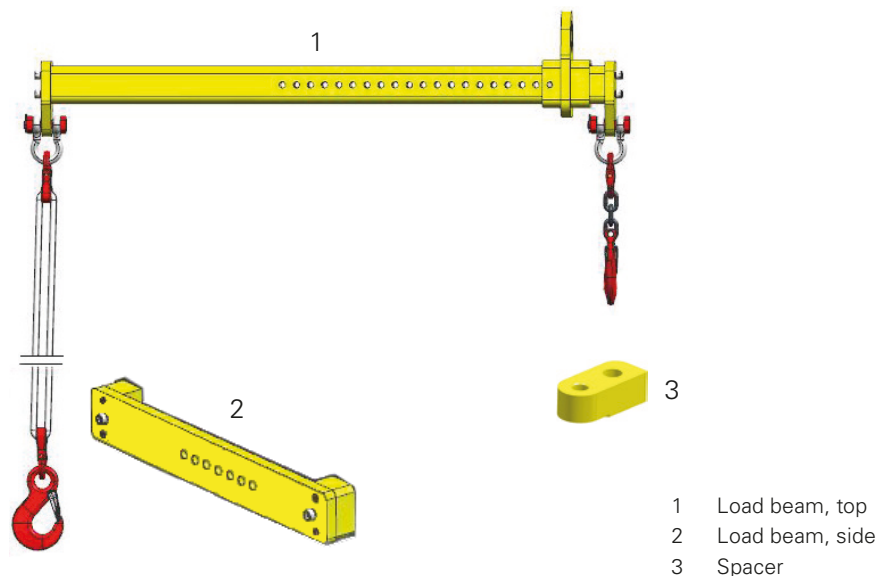

Space requirements

The following must be ensured:

- Sufficient free space around the machine.
- Sufficient movement space for the operator.
- Sufficient space for maintenance and repair.
- It must be possible to open all doors of the machine completely.
- Space for placing blank and workpiece pallets, workpiece collectors, chip trolleys, tool trolleys, etc.

Use the machine installation plan to determine the required space.

There are special installation plans for add-on equipment such as bar feeders, bar loading magazines, etc.

Floor condition

A special foundation is not necessary. Only the load-carrying capacity and strength of the floor area must be suitable for the machine weight based on constructional aspects.



Comply with the requirements set out in **DIN 18202:2019**. In particular, note the information regarding **"Flatness tolerance for finished floors"**.



There must be **no expansion joints** in the area of the machine footprint.



The guidelines and regulations applicable in the country of use must be followed.

Fastening/anchoring



In any case, the machine must be doweled to the floor.

Bar guides, bar feeders, and bar loading magazines must be anchored to the floor.

When attaching a robot cell from a third-party manufacturer, be sure to observe the relevant manufacturer's documentation.

Ambient conditions

See *Ambient conditions* in the "Safety Precautions and Technical Details".



If the actual conditions at the installation site differ from these specifications, be sure to contact the **machine manufacturer** or **its representative**.

Floor trough



If a floor trough is required, it must be designed according to the specifications "*Information on floor trough drawing*" so that extension of the corresponding chip conveyor is ensured.

The floor in the area of the floor trough must only be max. 5 mm convex, as flat or concave as possible. Exceeding the allowable unevenness may cause the floor trough to contact the machine base / machine components.

Compressed-air supply

See Chapter *Pneumatic connection*.

Operating material to be provided

See Chapters *Commissioning* and *Information on operating fluids*.

Pumps and tanks

A simple pump is sufficient to extract the used cooling lubricant. The same pump may be used to fill the cooling lubricant tank; however, it must be thoroughly flushed with fresh cooling lubricant.

A robust container is required for collecting the extracted fluids. Suitable containers are metal barrels of sufficient capacity and with proper labels, which can be tightly closed.

Connection to local extraction system by customer



If a local extraction system is attached to the machine, any existing fire extinguishing system available on the machine must be adjusted accordingly.

Power supply



The guidelines and regulations applicable in the country of use must be followed.



The power supply cord to the machine should be as short as possible.
Use a sufficient wire size.

The power supply for the machine requires stable mains conditions; the max. allowed operating voltage fluctuations are +10% or -10%.

The power line must comply with the regulations of the local electricity supplier and the VDE directives.

Main circuit breaker



Check that the building connection has sufficient capacity to cover the additional load to be protected.
Discuss any unclear conditions with your local electricity supplier.

The main circuit breaker is not included in the delivery of the machine. It must be installed outside the machine according to DIN EN 60204-1. If a pre-transformer is required, the main circuit breaker must be installed after the pre-transformer, i.e., on the secondary side. The fuse protection on the primary side must be designed according to the connection data of the pre-transformer.

The loads to be protected depend on the existing operating voltage.

For information on machine connection, operating voltage, main circuit breaker, see the electrical diagrams or Chapter *Electrical connection*.

External data transfer



Data cables must not be routed directly next to live cables.

For data transfer to/from external computers or servers/storage devices, suitable metal conduits must be installed for the data lines.

The connection to the internal network (DNC) requires an RJ45 network cable. An additional connection to the external network (IoT) must be made with a separate RJ45 network cable.

Chip removal

If the machine is equipped with a chip conveyor, a chip trolley, its height matching the chip conveyor's discharge height, is required.
The chip trolley should have a device for draining the accumulating cooling lubricant so it can be returned to the cooling lubricant tank.



Chip conveyor without discharge chute

The customer must provide a cover for the collection bin for the discharged chips when using a chip conveyor without a discharge chute.

The cover must be designed such that it is not possible to reach into the discharge chute.

Disposal of used operating materials



The guidelines and regulations applicable in the country of use must be followed.

Decide in advance on how to dispose of used operating fluids such as hydraulic fluid, lubricating oil, and cooling lubricant in an environmentally friendly manner.

Observing the ground and wastewater regulations



The guidelines and regulations applicable in the country of use must be followed.

The machine contains water-polluting substances such as water-miscible cooling lubricants and mineral oils. These substances may leak from the machine in case of adverse events.

Therefore, the machine must be installed in a place that excludes any harm by these substances to water or groundwater.

Possible preventive measures


- Place the machine inside a tight steel trough (floor trough).
- Seal the floor of the factory hall.

Delivery of the machine

The machine is delivered by truck.

The machine is in the following condition when delivered:

- Machine incl. control cabinet mounted on wooden planks (a).

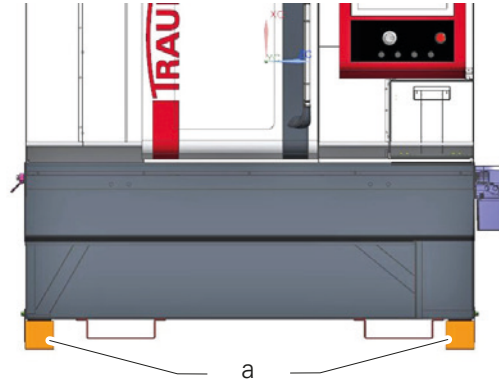

- Certain moving parts on the machine, such as the work area door and the swiveling operating terminal, are secured by transport locks or were removed.
- Protruding machine parts hampering the transport may have been removed.
- All blank parts of the machine were treated by spray-covering with an anti-rust agent.
- For operating material, see Chapter *Commissioning*.

Other separate units

Certain equipment levels or add-on equipment such as chip conveyor, bar feeder, bar loading magazine, etc., are usually separate units. Chip conveyors usually rest on a transport base for shipping. The bar feeder and bar loading magazine are delivered in a special shipping crate.

Loose parts, such as keys, tools, and fittings, are supplied in a separate box, which may be included with a separate unit.

Before unloading, check the machine, the enclosed accessories, and any separate units for external damages and completeness (compare the bill of lading with the delivery form).

Have the carrier confirm any damages or missing parts on the bill of lading or delivery form.

In case of damages during transport, it is recommended to take photos of the damages for evidence.

Notify the machine manufacturer or the machine manufacturer's representative.

**The control cabinet contains:**

- The necessary logs such as geometry or safety log
- Installation plan
- Key for the operating terminal
- Key for the fire extinguishing system (depending on the machine equipment)

On a separate pallet are:

- Accessories box
 - Screw-on brackets with threaded rods and mortar cartridge (2x)
 - Operator tools (such as special keys)
- User documentation
- Support feet
- For transporting with transport rollers
 - Mounting for the swivel plate of the steerable transport roller

Dimensions and weights**Machine TNL12.2**

The weight specifications refer only to the basic machine, i.e., **without** cooling lubricant unit and workpieces.

Length		
- Basic machine	mm	1900
Depth		
- Basic machine	mm	1100
Height		
- Basic machine (without indicator lamp)	mm	1600
Weight, approx. (with control cabinet and max. configuration)		
- Basic machine	kg	2500

Cooling lubricant unit

Compact belt filter variant		
Length	mm	3123
Width	mm	1262
Height	mm	1828
Weight approx. (with max. configuration)	kg	900



Twin strainer basket variant

Length		
- with chip conveyor	mm	2817
- with chip tray		2500
Width	mm	1310
Height	mm	1800
Weight approx. (with max. configuration)	kg	900

Machine center of gravity (S)

Center of gravity S* Basic machine	S1	S2	S3
mm	875	805	505

* Values may vary slightly

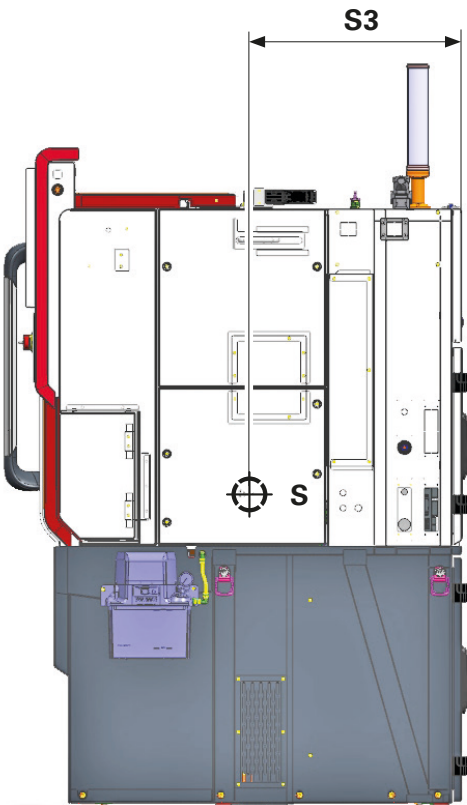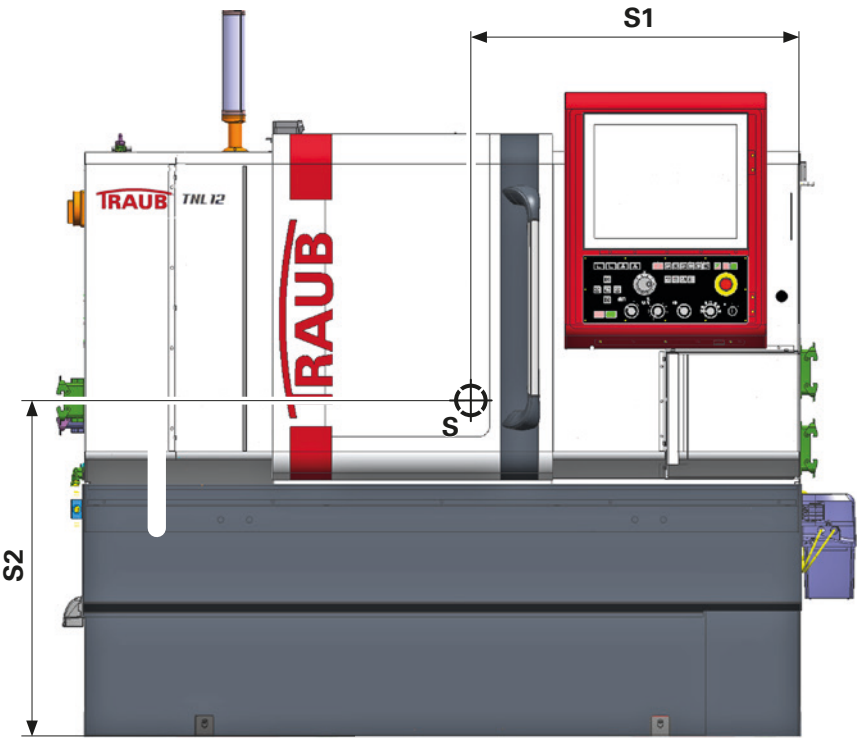

Transport by crane (min. 3 t capacity)





Danger from falling machine/parts

Keep away from under suspended loads.



The lifting device required for proper transport of the machine is supplied with the machine and must be returned to INDEX after the machine has been installed.

Illustrations show examples

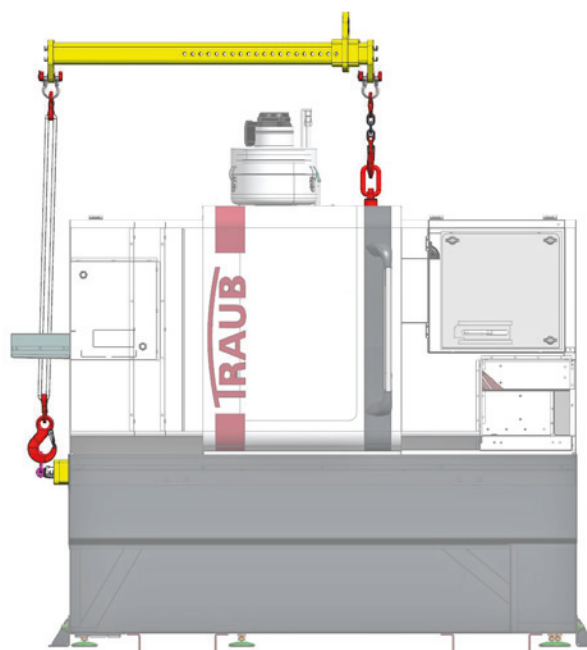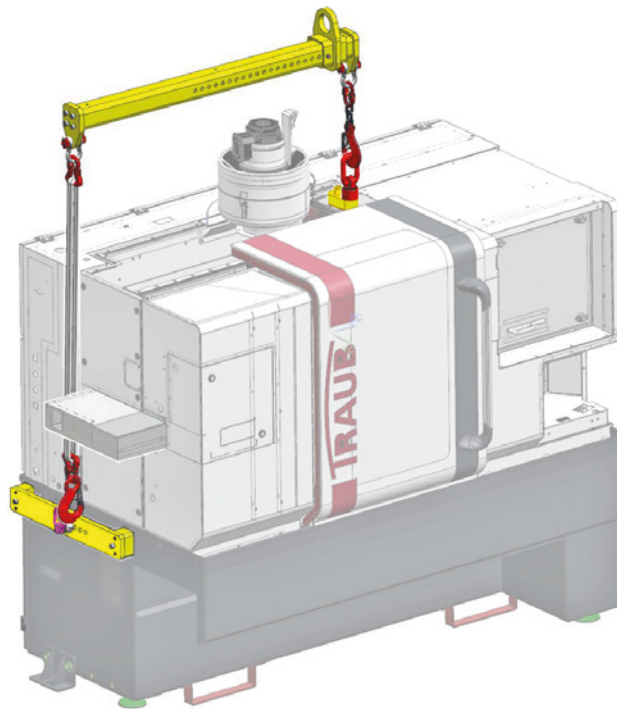


Attaching the lifting device components

For transport by crane, there is an M24 threaded hole under a cover on the top of the machine for screwing in a spacer, into which a load ring is mounted.


- If not yet installed, remove the cover (1) and screw in the spacer (2) and load ring (3).

Illustrations show examples

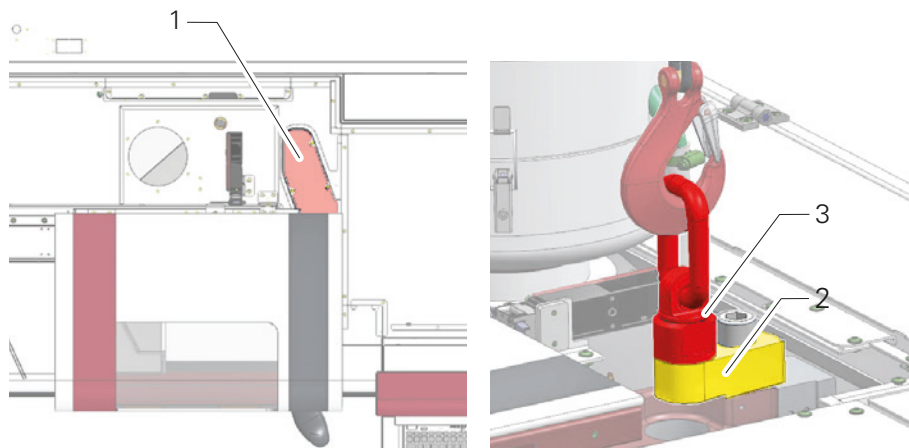

- Remove the two load stands on the left side of the machine and screw the lateral load beam (4) onto these threads. If necessary, screw in the lateral load ring (3).

Illustrations show examples

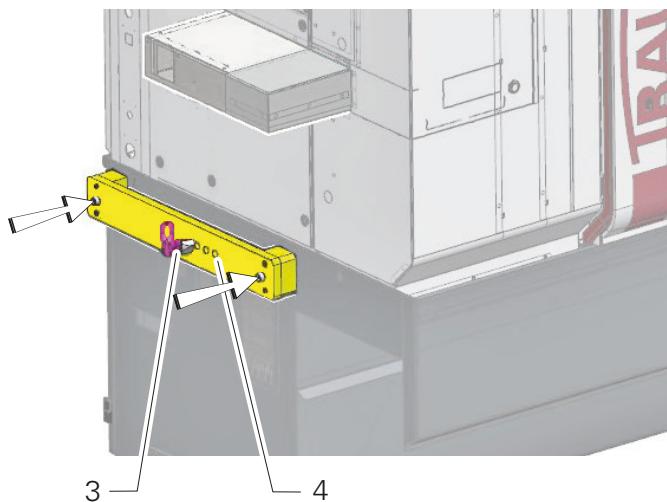

- 1 Cover
- 2 Spacer
- 3 Load ring
- 4 Lateral load beam

Attaching the machine to the lifting device

The machine must be suspended horizontally from the crane.

- Position the crane with the lifting device above the machine and attach the two safety hooks (5) to the load rings (3).





If necessary, the lifting device must be adjusted to match the machine (depending on the configuration level). For this purpose, the attachment position of the upper load beam (6) and the position of the load ring (3) on the lateral load beam (4) can be changed.



Danger from falling machine/parts

The lifting device may only be adjusted when it is not in use.


Basic setting of the lifting device

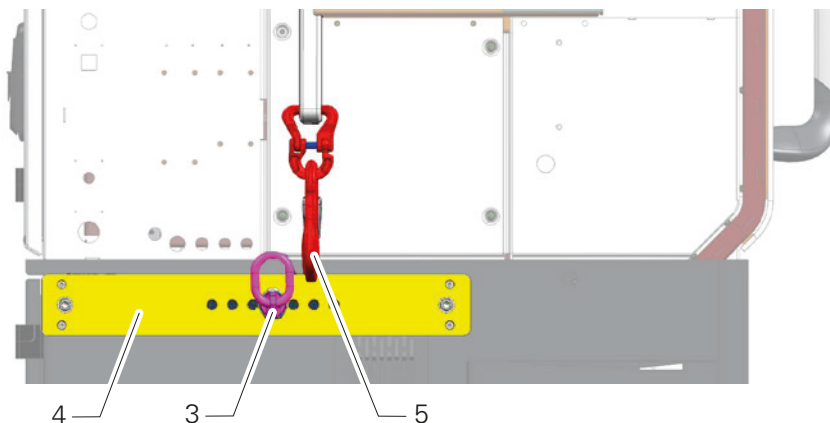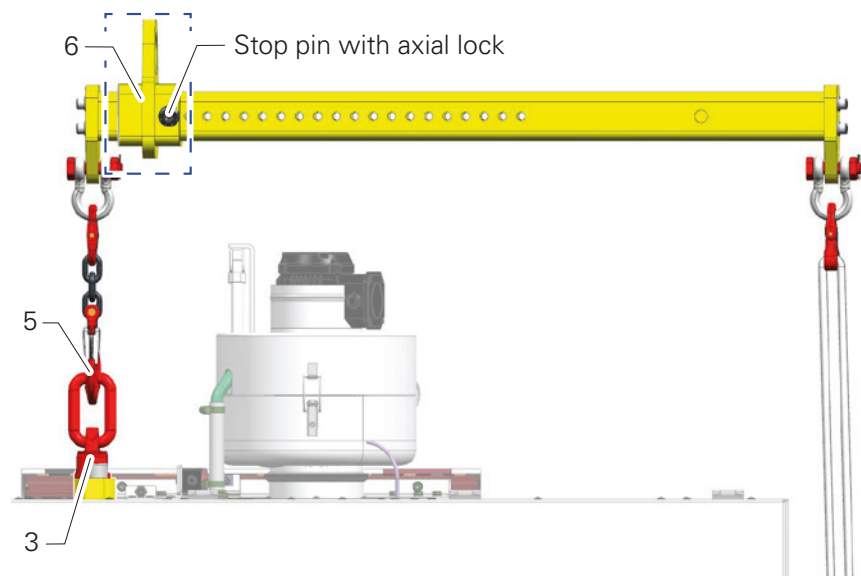


- 3 Load ring
- 4 Lateral load beam
- 5 Safety hook
- 6 Load beam

Remove the transport supports/transport lugs and wooden planks

- Slightly lift the machine and stabilize it with suitable supports.
- Dismantle the lateral retaining plates (a) for the wooden planks and remove the wooden planks and the anti-slip mats.

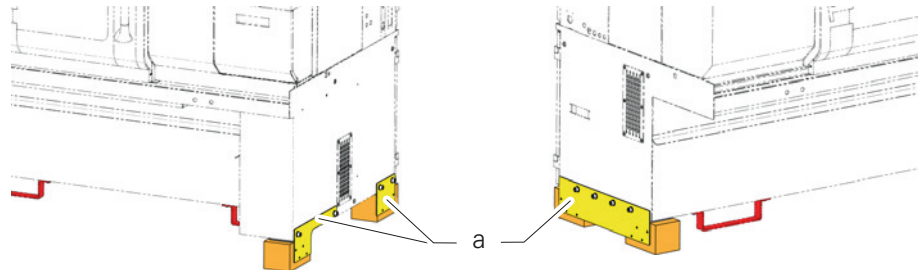

- Then screw in the 4 support feet (1) until they are in the same position and lock them slightly with the hexagonal lock nuts (2) so that the machine can be lowered onto the support feet (1) and the transport supports/transport lugs (3) are free.
(The support feet are included in the machine accessories.)

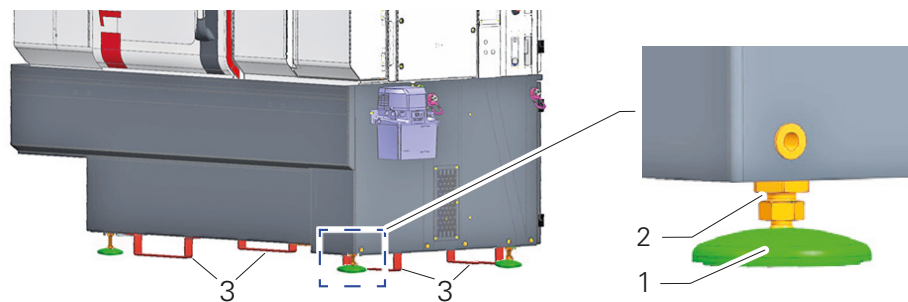

- Remove the transport supports/transport lugs (3).




Keep the transport supports/transport lugs (3) after removal (e.g., for a new transport or decommissioning).


- Lower the machine slowly and evenly onto the support feet (1).

- a Retaining plate for wooden plank
- 1-2 Support foot; hex. lock nut
- 3 Transport support/transport lug

- Remove the spacer and load ring and install the cover.

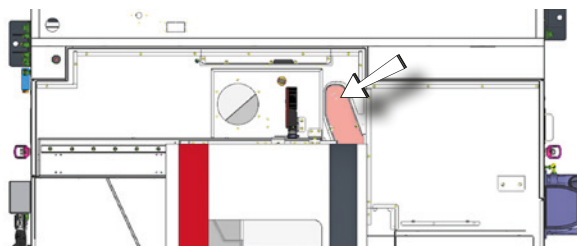

- Remove the lateral load beam.

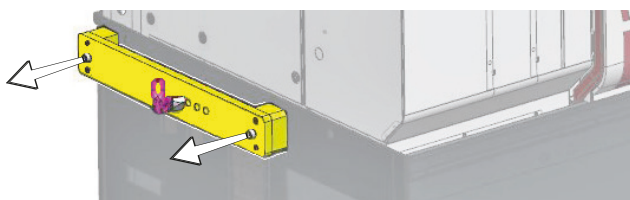

Transporting with a forklift**Danger from falling machine/parts**

Keep away from under suspended loads.



Transport with a forklift must be carried out from the control cabinet side.

**Danger from tilting of the machine!**

If the machine is transported by forklift, it must be secured against tipping!

Attention must be paid to the center of gravity of the machine.

Anti-slip mats should be placed on the fork arms when transporting the machine.

Lift the machine from the control cabinet side using the transport supports/transport lugs provided.



When setting down the machine, make sure that the forks are not tilted.

Technical requirements – forklift

Lifting force min. (depending on the machine configuration)	kg	3000
Min. fork length	mm	1400
Center of gravity of the load	mm	—
Max. fork width	mm	250
Max. fork height	mm	70


- Move the machine to the installation site by forklift and place it in the desired installation position.

Illustrations show examples

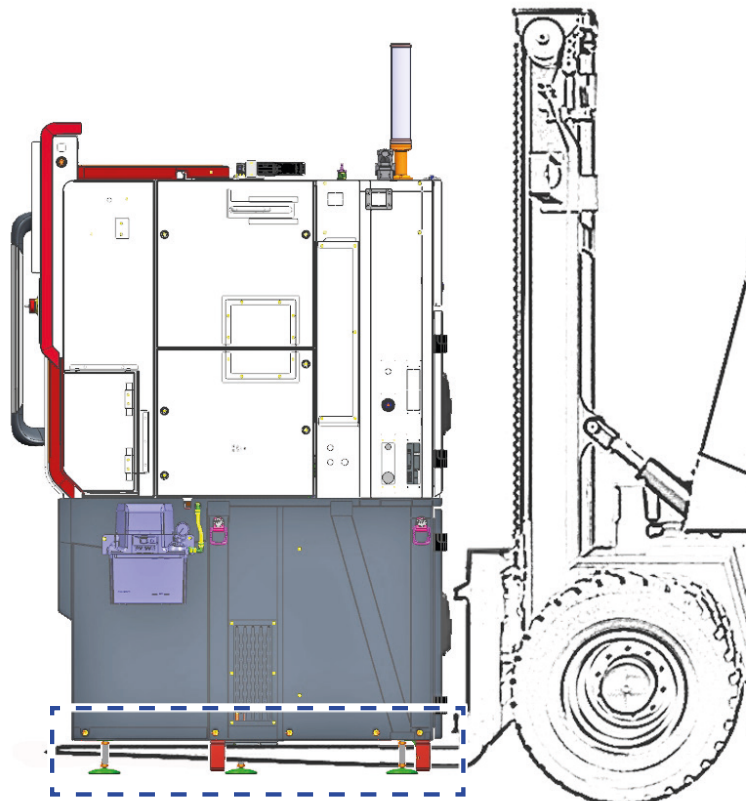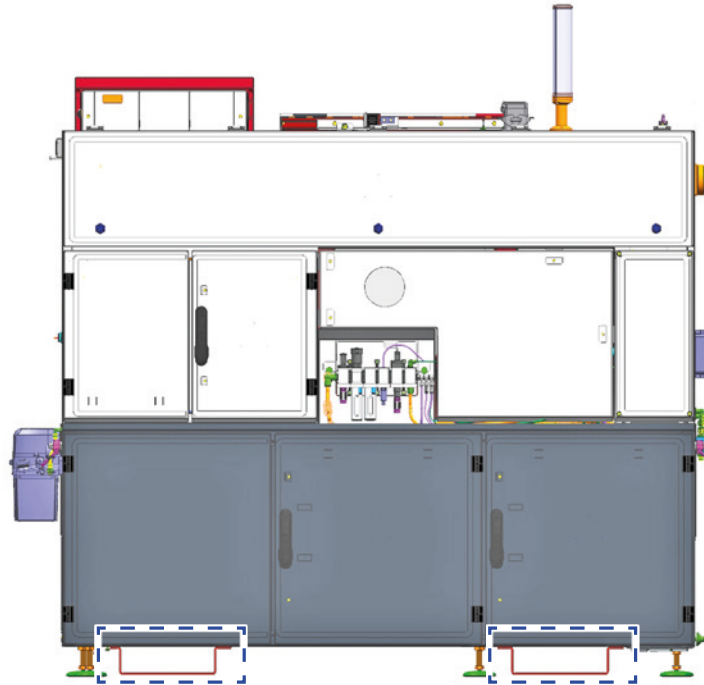


Remove the transport supports/transport lugs and wooden planks

- Slightly lift the machine and stabilize it with suitable supports.
- Dismantle the lateral retaining plates (a) for the wooden planks and remove the wooden planks and the anti-slip mats.

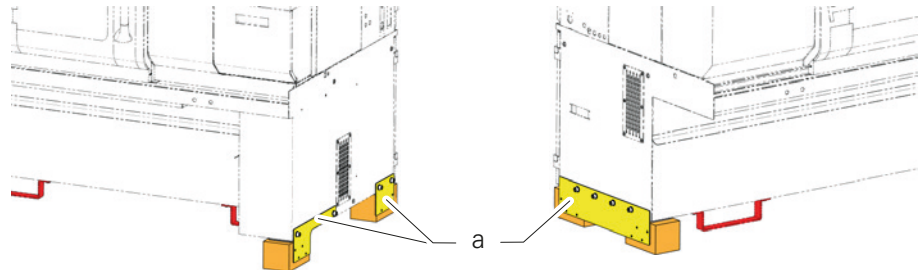

- Then screw in the 4 support feet (1) until they are in the same position and lock them slightly with the hexagonal lock nuts (2) so that the machine can be lowered onto the support feet (1) and the transport supports/transport lugs (3) are free.
(The support feet are included in the machine accessories.)

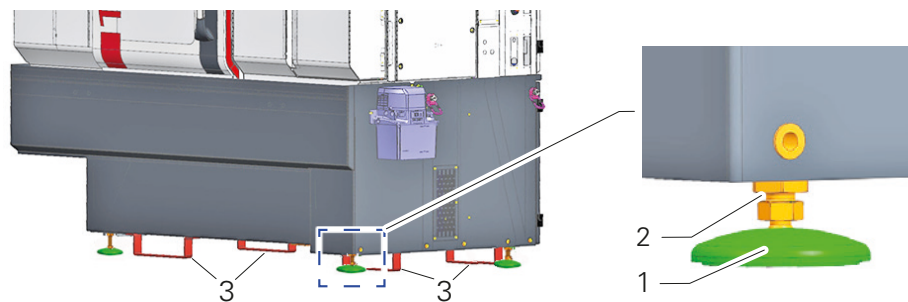

- Lower the machine slowly and evenly onto the support feet (1).
- Remove the transport supports/transport lugs (3).



Keep the transport supports/transport lugs (3) after removal (e.g., for a new transport or decommissioning).

- a Retaining plate for wooden plank
- 1-2 Support foot; hex. lock nut
- 3 Transport support/transport lug

Transport with transport rollers



Risk of crushing on ramps or uneven floors!

Secure the machine against unintentional rolling away.



Danger from tilting of the machine!

If the machine is transported with transport rollers, it must be secured against tipping!



Pay attention to the machine's lateral center of gravity

Due to the machine's high center of gravity, we recommend transporting with transport rollers only if the ground is absolutely even and horizontal.




Attaching the transport rollers

For transport with transport rollers, the support feet must be removed.

The trolleys must always be parallel to the load.

Connect the rigid transport rollers with a rod.

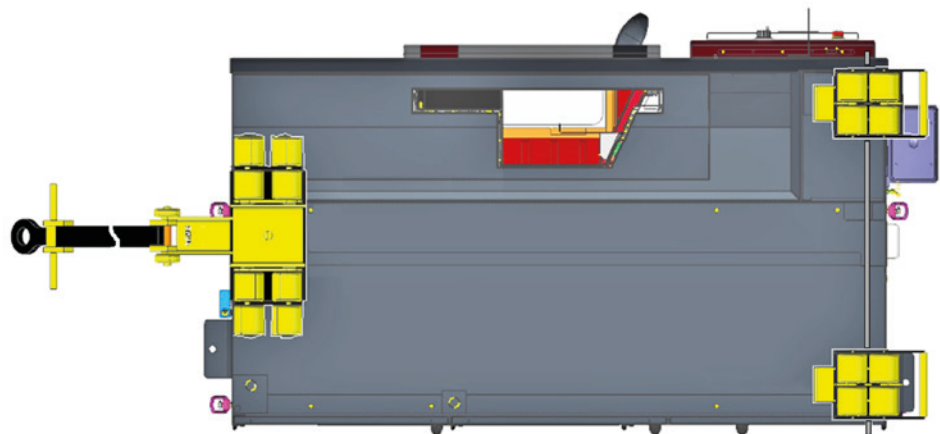

Plastic plates or Teflon plates can be used to bridge smaller unevennesses and to reduce rolling resistance.

This applies in particular to transporting on irregular or soft grounds such as industrial parquet floors or rubber or PVC-based floor covers.

To transport the machine, 3 transport rollers are required, one of which must be steerable.

Technical requirements – transport rollers

Height	mm	max. 110
Rotary table	mm	max. dia. 150
Capacity	kg	up to 6000


e.g., transport rollers type JLB 3 K, JFB 3 K, for loads up to 6 t

Remove transport supports/transport lugs and wooden planks

After removing the transport supports/transport lugs and wooden planks, the machine can be set down on transport rollers with hydraulic jacks and transported to the installation site and/or moved to the desired installation position.

- If necessary, lift the machine evenly by means of the 4 support feet (1) until the transport supports/transport lugs can be (3) removed.
- Lock the support feet and remove the transport supports/transport lugs (3).

Example shown

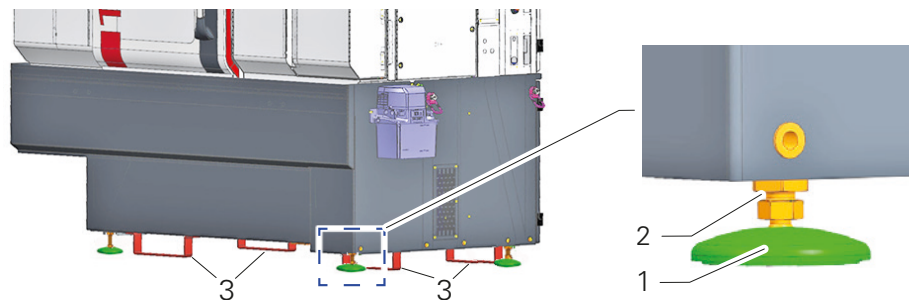


- Remove the transport supports/transport lugs (3).



Keep the transport supports/transport lugs (3) after removal (e.g., for a new transport or decommissioning).

- Mount the holder (4) for the swivel plate of the steerable transport roller in the position provided.
(The mounting (4) is included in the machine accessories)

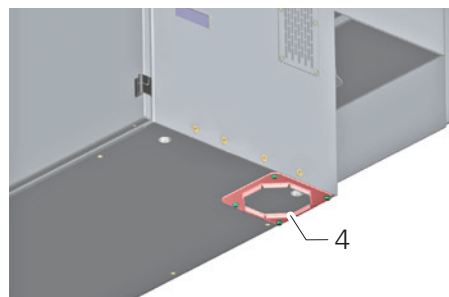

- 1-2 Support foot; hex. lock nut
- 3 Transport support/transport lug
- 4 Mounting for swivel plate of steerable transport roller



Positioning the hydraulic jacks



Risk of crushing on ramps or uneven floors!
Secure the machine against unintentional rolling away.

2-3 hydraulic jacks are needed to lift the machine.

- Attach the hydraulic jacks as shown.

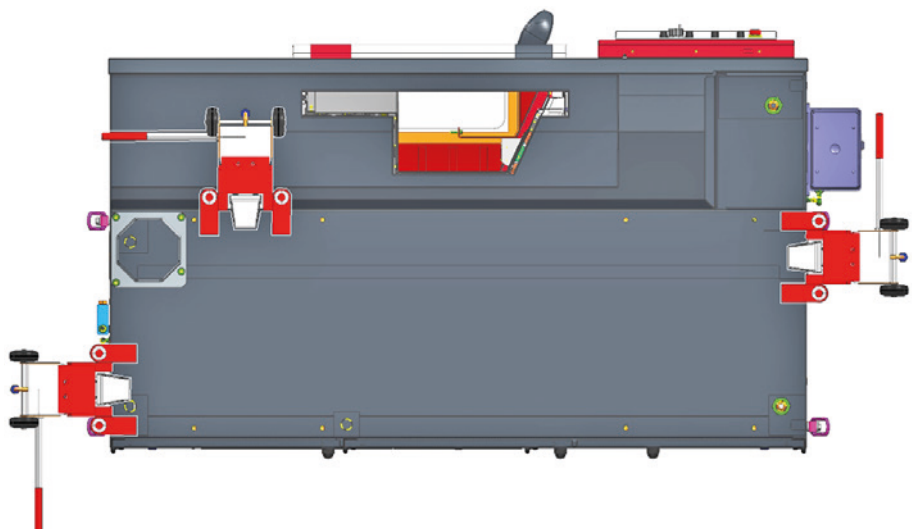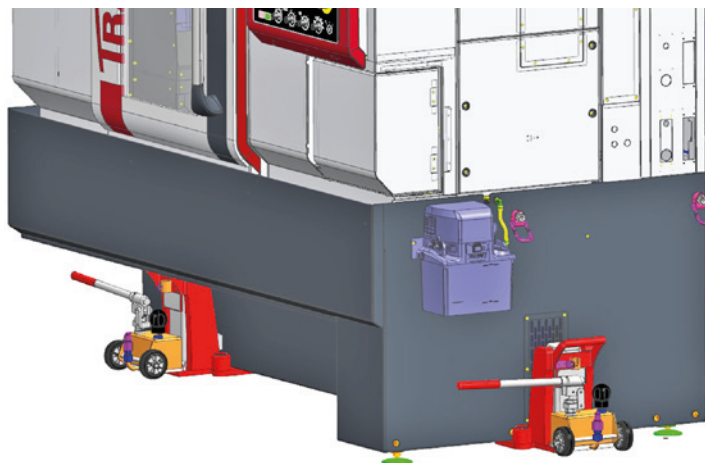

Placing the machine on transport rollers



Risk of crushing on ramps or uneven floors!

Secure the machine against unintentional rolling away.


- Evenly lift the machine with the hydraulic jacks.
- Remove the 4 support feet.
- Position the rigid transport rollers under the machine as indicated (1), then carefully lower the machine onto the rigid transport rollers.
- Then place the steerable transport roller (2) in the position (a) provided for this purpose under the machine and carefully lower the machine. Make sure that the steerable transport roller rests positively in the center of the turntable.



Using 2 hydraulic jacks

When using two hydraulic jacks, lift the machine sides in small steps alternately and always secure the machine by supporting it (e.g., with wood).

First position the rigid transport rollers, then position the swivel plate of the steerable transport roller positively in the holder (a).

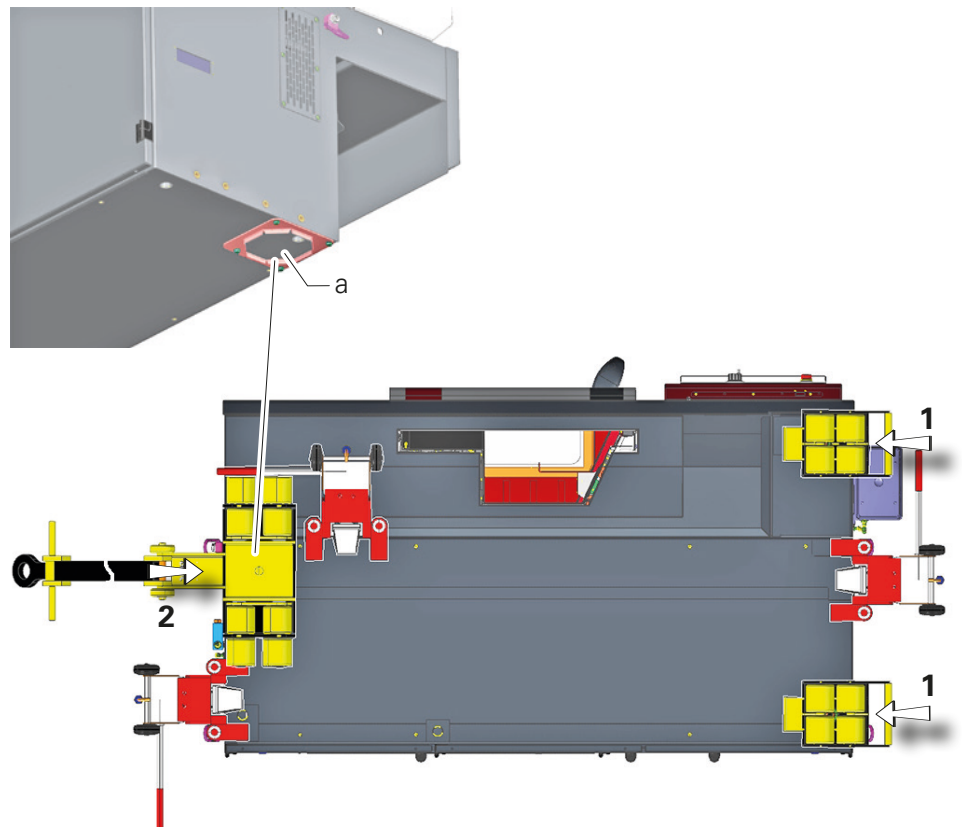

- Remove the hydraulic jacks.

- Transport the machine to its installation site or move it into the position required for installation and secure it so that it cannot roll away inadvertently.

Place the machine on the installation items.

For installation items **A-D**, see Chapter "Installation plan".
The machine is aligned exclusively with the installation items **A, B**, and **D**.
Fully relieve installation item **C**.

- Place the machine on the installation items **A, B**, and **D**.
Installation item **C** must still be completely unloaded.

Indicator lamp

Connect the indicator lamp to the control cabinet if it has been removed during transport.

Electrical connection**Important notes****Caution! Danger to Life!**

All work on the electrical equipment must be carried out exclusively by properly trained qualified personnel.



The control voltages are connected on one side with PE according to EN 60204-1. See the information on the wiring diagram.

The control cabinet may only be opened when the main switch is switched off. While the main switch is switched on, the control cabinet must be secured according to valid safety standards.



See the order confirmation for the precise electrical requirements.
The electrical documentation supplied is definitive and binding. They must be available to **INDEX**'s customer service at any time.

The machine must be connected to the electrical supply network via the main switch (multi-wire cable). The connection must be made with a clockwise rotating field.

The power connection is indicated in the wiring diagrams.

The machine is prepared for connection to three-phase power lines (TN-S network).

Before connecting the machine, check that the existing power settings and network form of the respective power supply company match the ratings defined for the machine.

If this is not the case, an upstream transformer is required.



The guidelines and regulations applicable in the country of use must be followed.

Removing the transport locks from the machine

- 

All transport locks must be removed before installing the cooling lubricant unit or before commissioning the machine.
- 


Removing the transport lock
During removal, all screws of the transport lock must be removed.
- 

Keep the transport locks after removal (e.g., for renewed transport or decommissioning).


Locations of the transport locks on the machine

Position	P/N of the transport lock	
Main spindle	12069162	Bracket
Counter spindle and back working unit	12069161	Bracket
Upper tool carrier and front working unit	12069130	Bracket
Operating terminal	12080287	Bracket
Work area door	12069118	Bracket


Transport lock – main spindle

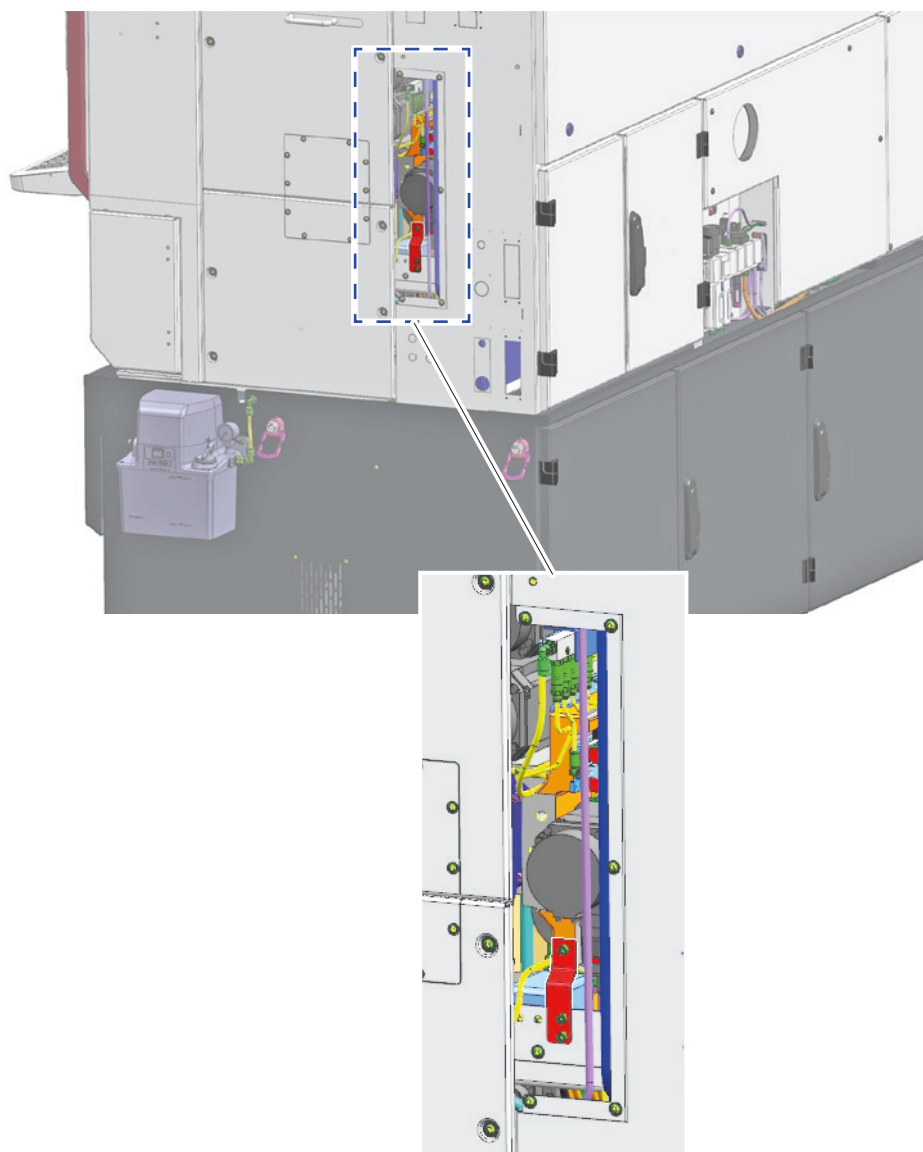


Transport lock at counter spindle and back working unit

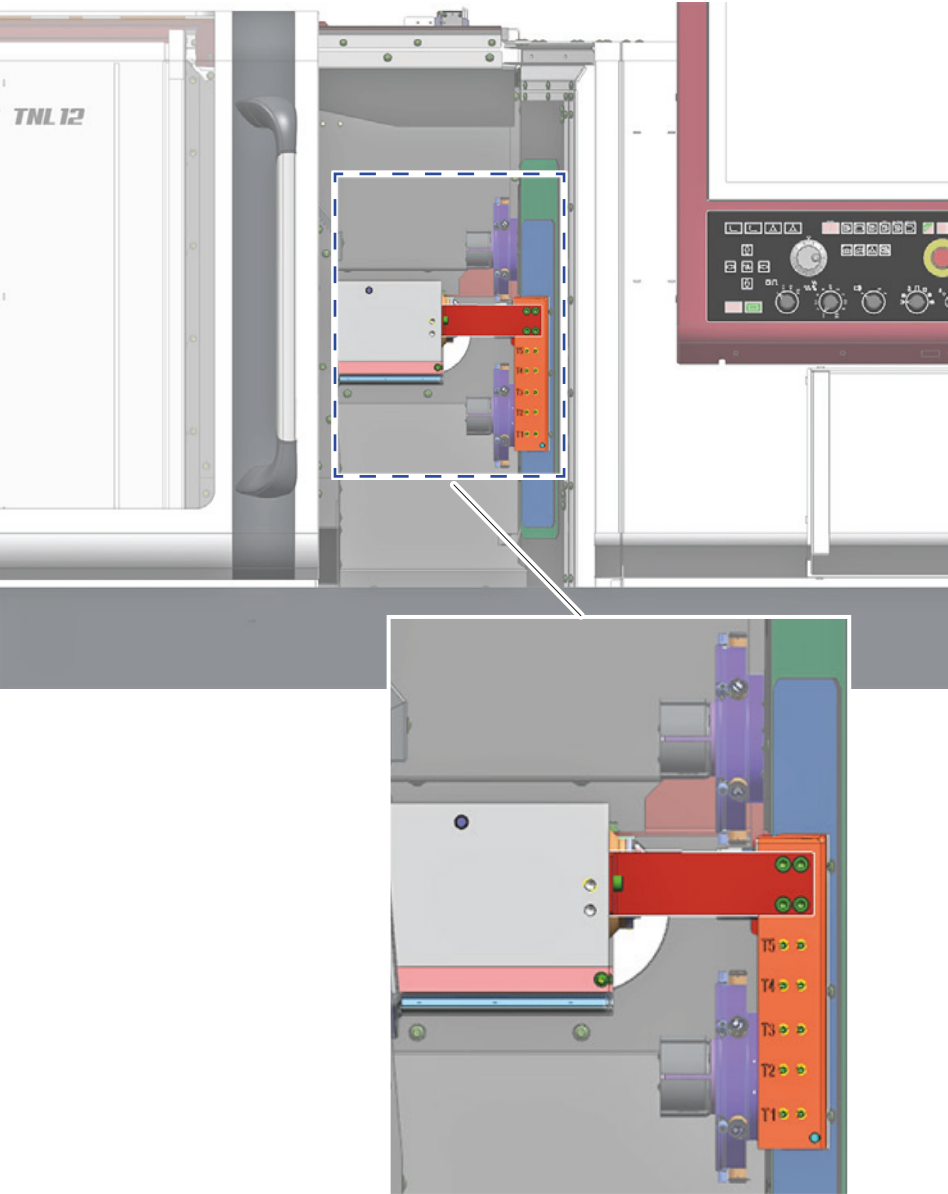



Upper tool carrier and front working unit

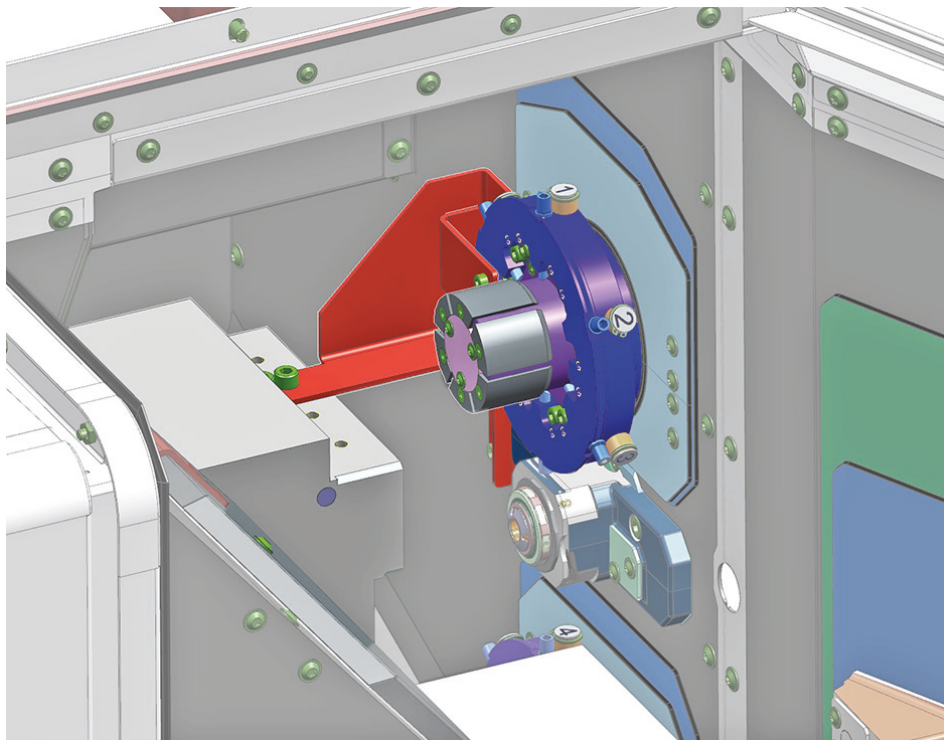

Transport lock at operating terminal

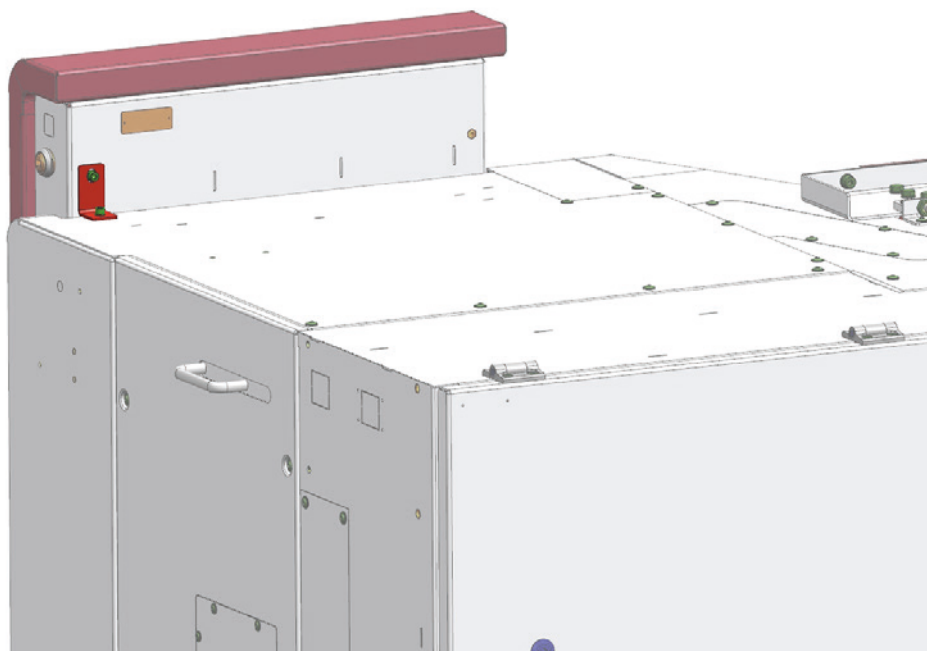

Transport lock at work area door

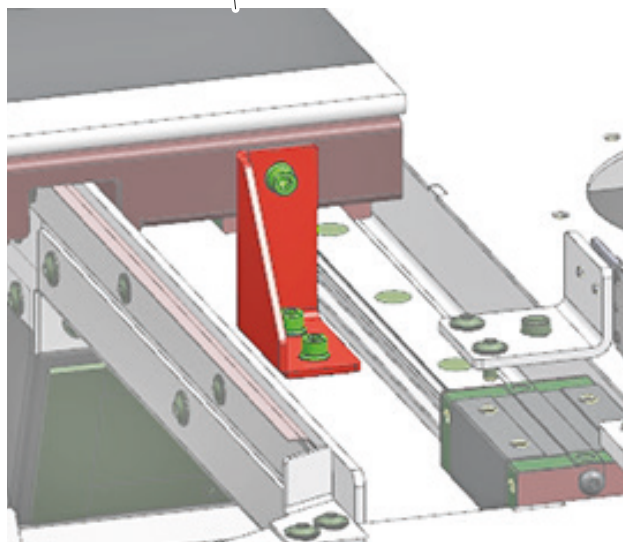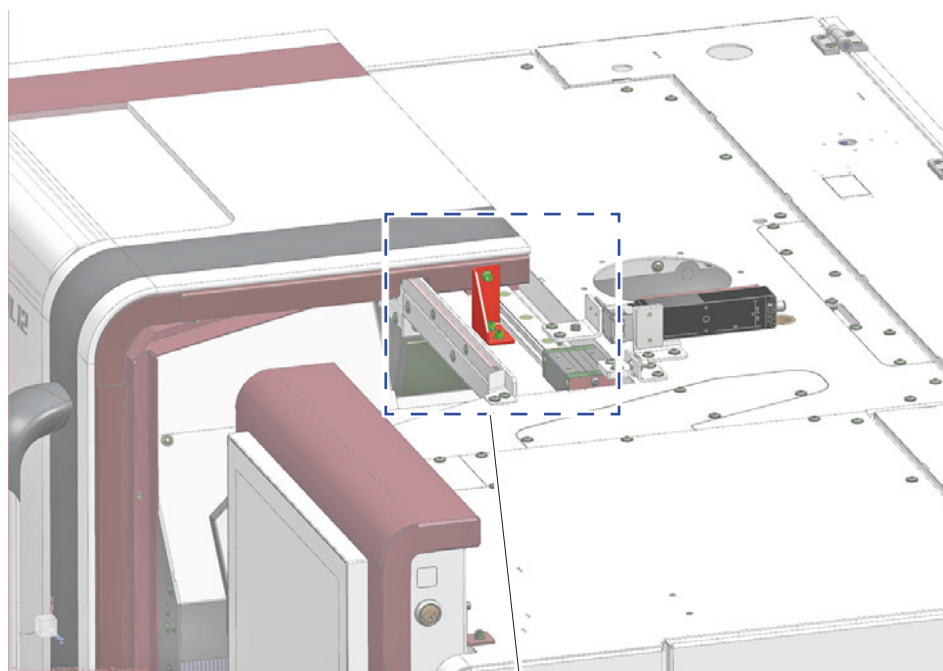

Leveling the machine


Tools required:

- Spirit level (accuracy 0.02/m).
- Dial gauge with touch probe (accuracy 0.01 mm) and magnetic stand.
- Place spirit level on the support surface on the counter spindle (4).
The position of the counter spindle corresponds to the position with a transport lock.

If necessary, move the counter spindle to the position (see "Axis positions for attaching the transport locks").



Follow Chapter "Commissioning".

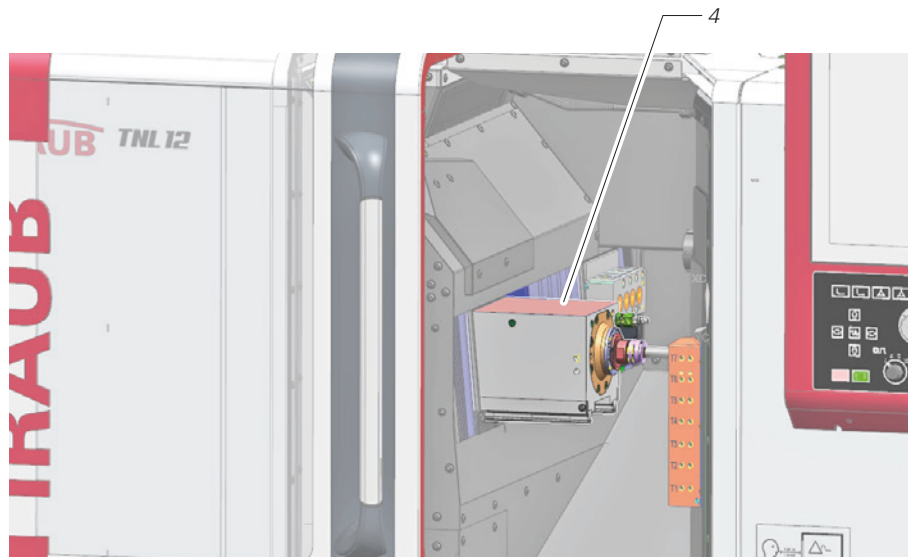

- Level the machine to the height position of **1150 mm of main spindle height** by turning the adjusting screws **A**, **B**, and **D**.



The machine must be adjusted exactly to **1150 mm main spindle height** so that the chip conveyor can be inserted. The maximum permissible deviation is 0.5 mm per 1000 mm.

- Level the machine with a spirit level.



After approx. 12 hours, check the alignment of the machine again and readjust if necessary by turning the adjusting screws of the installation items **A**, **B**, and **D**.

- Lock the adjusting screws of the installation items **A**, **B** and **D** with the hexagon nuts.


Fastening/anchoring to the floor

- Screw the two connection brackets (b, d) to the machine base at the positions provided such that they can still be moved.

Position of the connection brackets

Connection bracket 1 -> Installation items **B**

Connection bracket 2 -> Installation items **D**

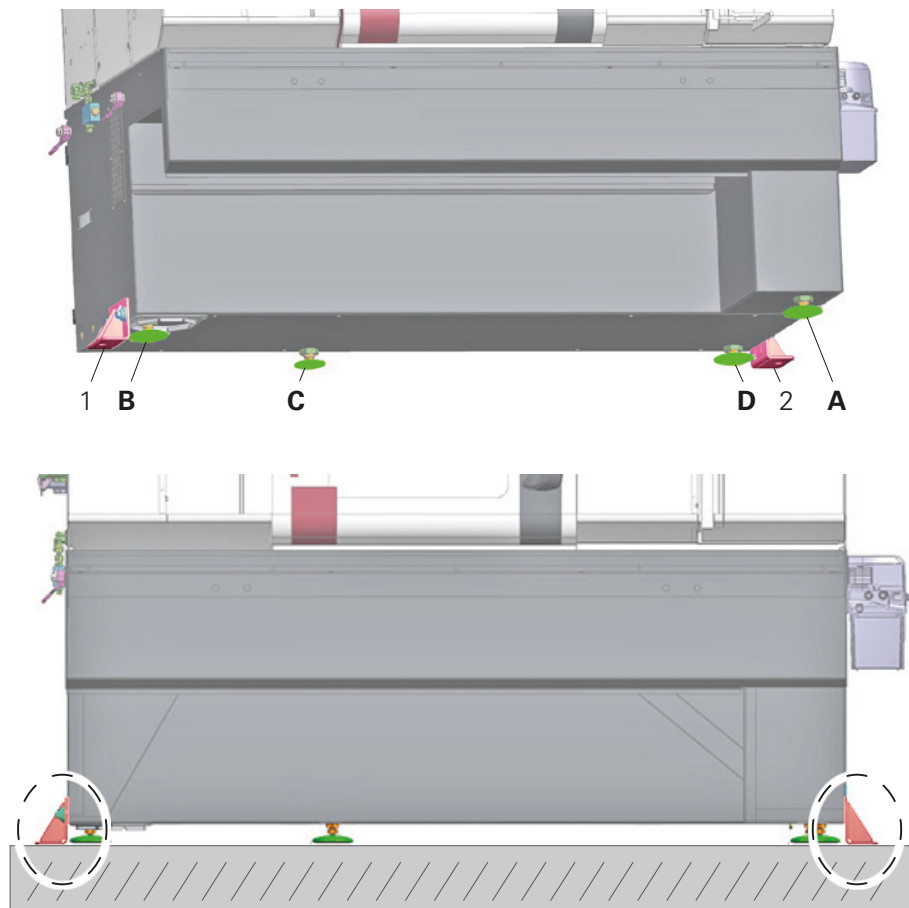

- Use an 18 mm dia. masonry drill to drill a 125 mm deep hole in the foundation through the holes in each of the connection brackets.
- Insert a mortar cartridge and threaded rod (M16x250) (included in machine accessories). The length of the threaded rod may need to be adjusted.




Follow the documentation of the manufacturer of the mortar cartridge.

- After the curing time specified by the manufacturer for the mortar cartridge, secure the machine to the threaded bars without tension with the hexagon nuts and washers (tightening torque max. 80 Nm).

- Attach a dial gauge with magnetic stand to the machine base on installation item **C** and place the touch probe against the floor at right angles.

Example shown: Touch probe on installation item C

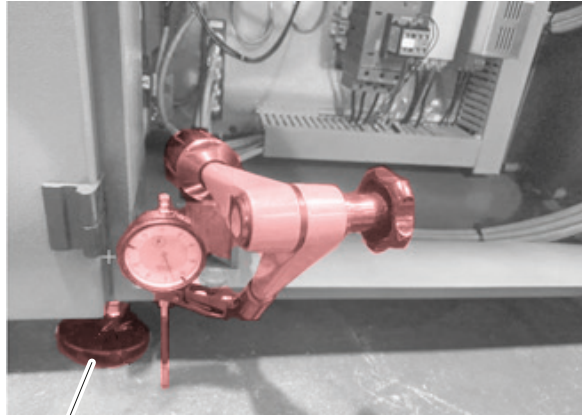

C

- Position the installation item **C** with a preload of 0.05 mm.
- Lock the adjusting screws of the installation item **C** with the hexagon nut.
- Recalibrate the reference points.



Follow Chapter "Commissioning".



For calibrating reference points, see document "Operating the Machine" - "Setup of the Machine".

- Check the geometry of the machine once more and readjust if necessary.


Connecting the machine to central extraction unit**Shutoff damper for fire protection****Operating the machine with cutting oil**

When operated with cutting oil, the machine is fitted as standard with a shutoff damper for fire protection.


**Operating the machine with emulsion**

If the operator/owner does not have a shutoff damper for fire protection in the central extraction system, it must be installed by the machine manufacturer's service personnel when the machine is installed.


Mechanical preparation for central and local exhaust system.

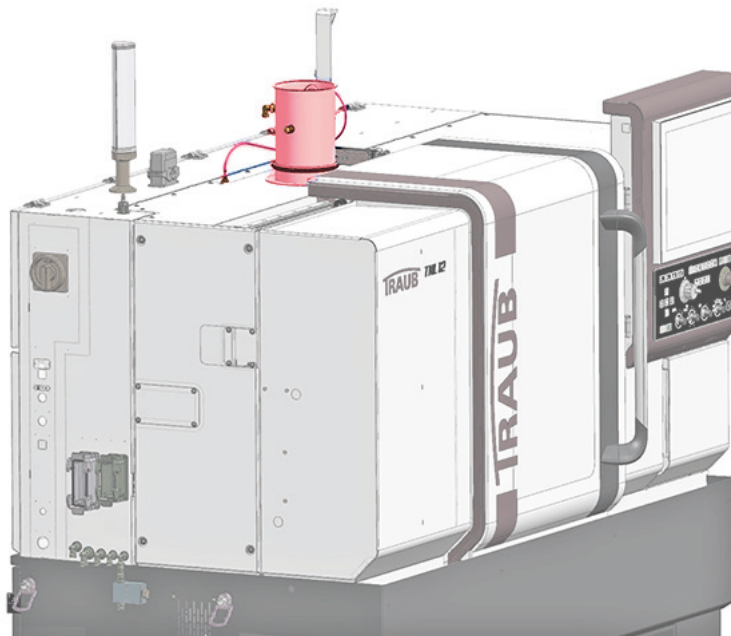

Adding a local extraction system without a fire extinguishing system

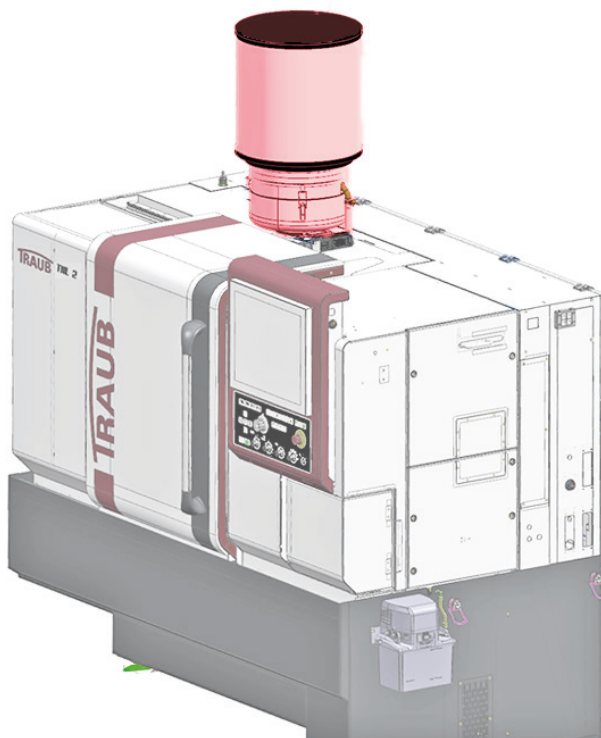

Adding a local extraction system with a fire extinguishing system or shutoff damper

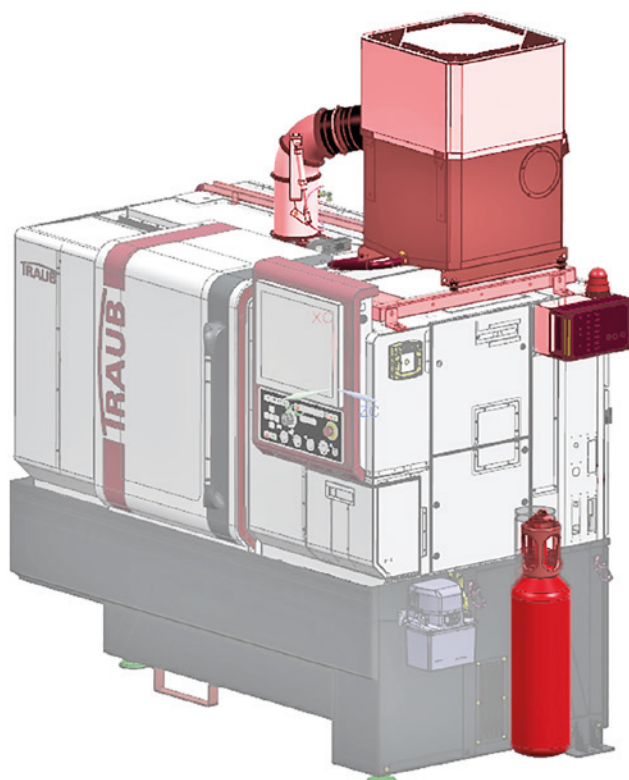


Transporting and installing the cooling lubricant unit




Follow the manufacturer's documentation.

- Move the cooling lubricant unit to the machine location and lift it off the pallet using suitable lifting equipment and place it on the rollers.

Illustrations show examples

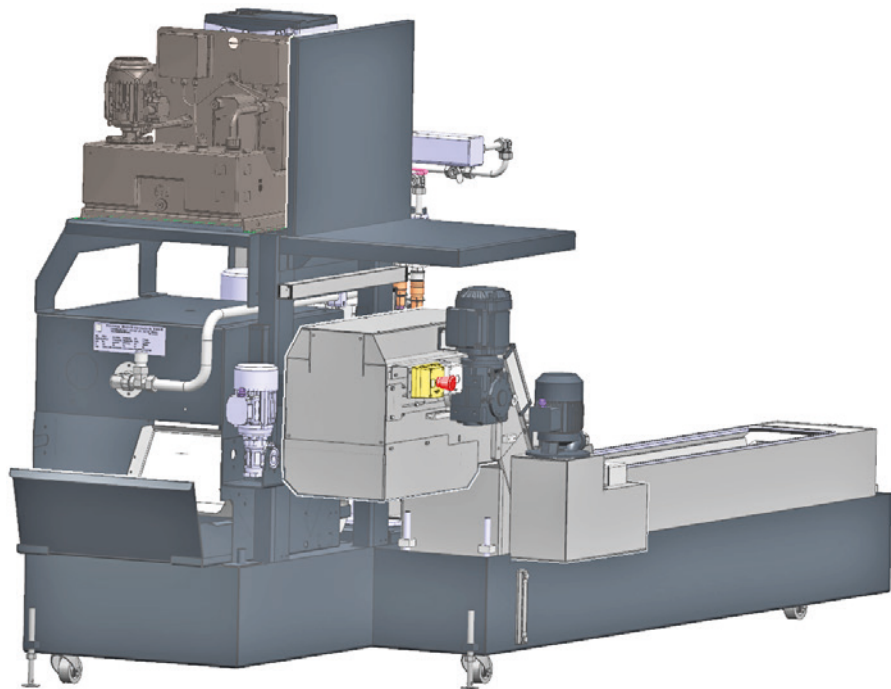



Optional
Chip conveyor with extinguishing nozzle and CO₂ tank

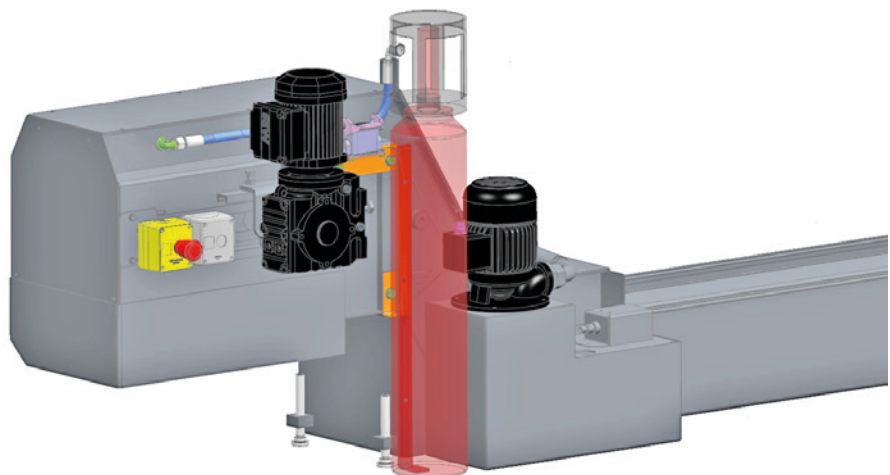

Installing the cooling lubricant unit

- Push the cooling lubricant unit from the left side of the machine under the machine (1.), then push it to the right until it stops (2). Make sure that the front of the chip conveyor is flush with the machine base (3).

Illustrations show examples
(Cooling lubricant unit with compact belt filter)

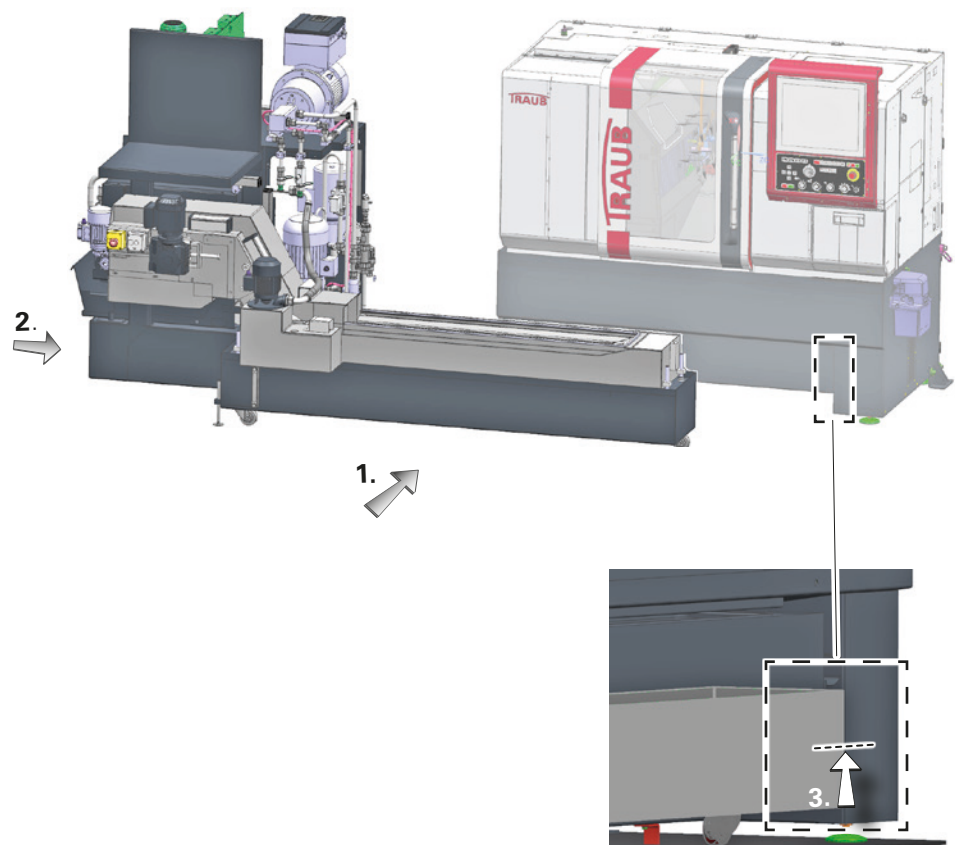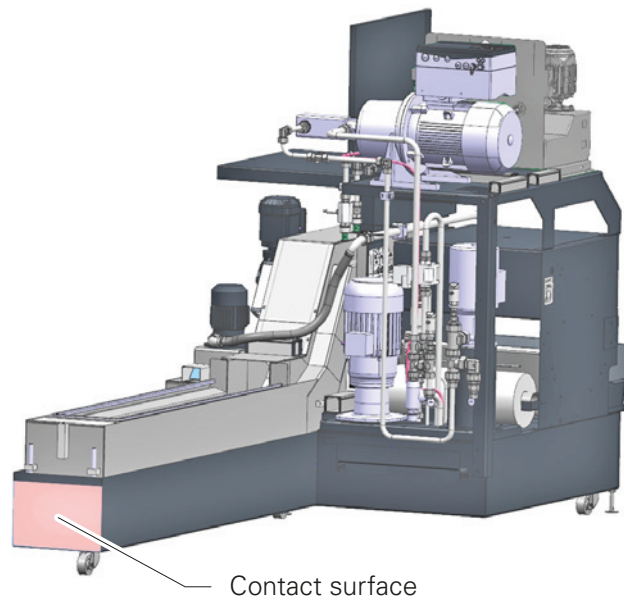


Sealing of cooling lubricant unit / machine

Seal the joint between the cooling lubricant unit and the machine through a sealing lip.

- Adjust the cooling lubricant unit evenly by means of the adjustable feet, except for a circumferential gap of 2 mm between the machine and the chip tray.

Illustrations show examples

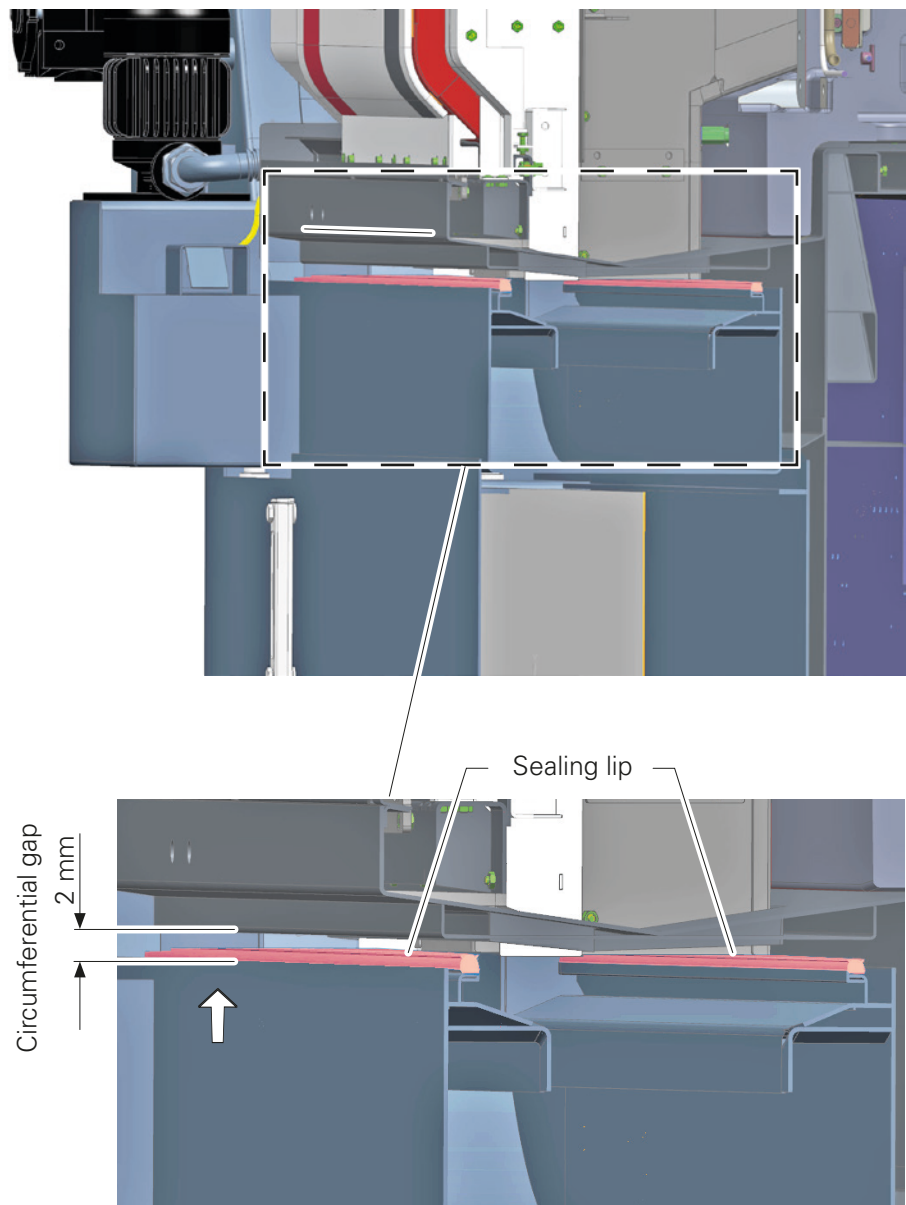

- Fix the adjustable feet using the lock nuts.

Connecting the cooling lubricant system



If the spindle cooling (water-water cooling) is realized through a central cooling system, the hose connection should be provided with a stopcock or a quick-connect coupling to allow cleaning of the chip conveyor.

- Remove the blanking plugs from the connection kits and connect the connection kits to the machine and cooling lubricant unit according to the marking
- Electrical connection of the cooling lubricant system.

Provision of compressed air

For all work in connection with operating materials, observe the information in the data sheets from the respective manufacturers and the information in the document *Information on operating fluids*.

The required amount of the operating materials to be filled can be obtained from the relevant fluid diagrams.

The required compressed air is conditioned in a maintenance unit that requires no adjustments.

Pressure gauges are available to check normal functionality.

Air consumption

Air consumption is influenced by the machine configuration and cycle time. On average, approx. 100 NI/min is set for a standard machine.

This section lists all the actions that must be carried out in the order given before the machine is ready for start-up.

Only then is the machine ready for operation.



Before commissioning the machine, unscrew all transport locks (**recognizable by their red color**) and keep them for another transport in the future.

See also the section "Locations of the transport locks on the machine".

Cleaning the machine

All blank parts of the machine were treated by spray-covering with an anti-rust agent. Usually, this protective cover is flushed away by the coolant during the operation of the machine.



To prevent solvent splashes from entering the eyes when cleaning the machine, Be sure to wear suitable safety goggles.

For cleaning the inside of the machine's work area, protect your hands and arms by wearing clothes with long sleeves and suitable gloves.

Risk of injury by sharp machine parts and cutting edges!

The anti-rust agent must be washed off if the machine is put into operation after a long time and the protective layer has become very tough.

The mounting surfaces for tool holders and add-on equipment must also be cleaned.

For this purpose, only solvents may be used that do not affect the machine paint. Suitable solutions are turpentine, petroleum, or benzene.

Check the working media levels and replenish, if necessary

For all work in connection with working media, the information in the data sheets of the respective manufacturers and the information in the document *Information on operating fluids* must be followed.

The required amount of the working media to be filled can be obtained from the relevant fluid diagrams.

Cooling lubricant unit: Replenish cooling lubricant

Central lubrication system: Check fill level

Cooling (spindle): Check fill level

Add-on equipment: Check fill levels

Data loss due to prolonged downtime

The machine is functional only after all data have been entered.

After a prolonged downtime of the machine, data may be lost in the RAM. In such a case, the lost data must be re-entered or re-loaded before the machine can be put back into operation.

The data are recorded in the start-up report and backed up on a storage medium. The start-up report and the storage medium are located in the document pocket in the door of the control cabinet.

Switching on the machine



Before switching on the machine, the key switch must be in the **"Production mode"** position to prevent unexpected starting or unexpected movement.



Before initial commissioning, the machine operator/owner is required to check the safe condition of the machine, including its safety devices. This must also be done during operation at reasonable regular intervals, but at least after each repair and maintenance.



- Switch on the machine.
See document "Operating the Machine" - "Setup of the Machine".

Preparing the machine for transport

Transport locks on the machine

Certain moving parts/assemblies on the machine, such as the work area door and the swiveling operating terminal, must be secured for transport by transport locks.

The transport locks are included in the delivery of the machine.



See Section "*Locations of the transport locks on the machine*".

Be sure to clean the contact surfaces of oil and grease before reattaching the transport locks.

Locations of the axes for attaching the transport locks

	Axis	Position
Main spindle		
Sliding/fixed headstock operation	Z1	+ 233.9
Counter spindle	Z4	+ 8.8
	Y4	+ 317.0
Upper tool carrier	Z2	- 13.5
	X2	+ 115.0
	H2	any station
Lower tool carrier	X1	+ 153.1
	H1	any station
Front working unit	Z3	+ 50.0
	X3	+ 64.0
Workpiece removal unit	Z5	retracted
Back working unit	X4	+ 182.5
Work area door	Z	+ 439 (completely open)
Operating terminal		folded


Drain the hydraulic tank before transport

When carrying out work on fluid systems (hydraulic, lubrication, and pneumatic systems), make sure before starting the work that the respective system has been depressurized (accumulator drain valve / manual slide valve / emergency stop).

Seal disconnected hose lines or pipelines

In order to prevent leakage of the remaining cutting oil or cooling lubricant from the lines, the disconnected connection kits or pipelines must be sealed with plugs.

Example shown

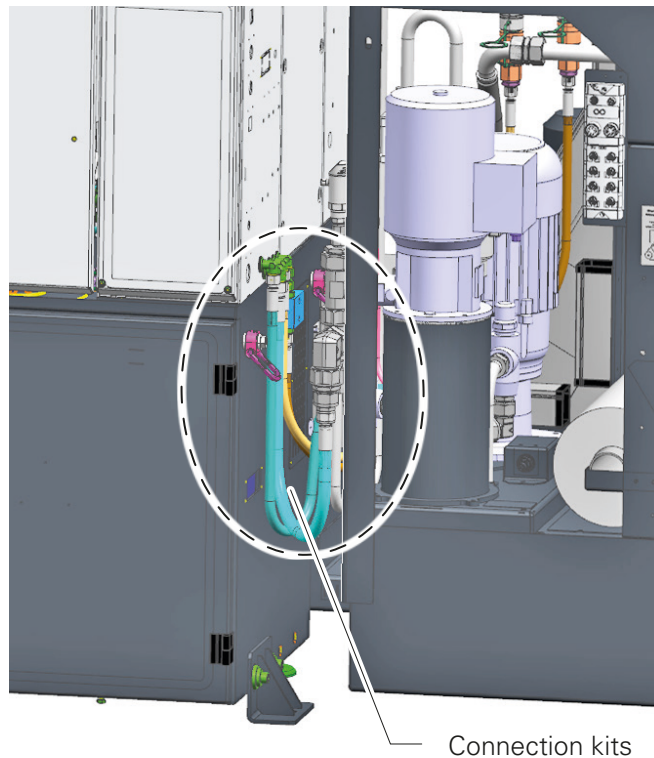**Corrosion protection**

Before delivery, all machines are provided with corrosion protection. For every further transport, the corresponding corrosion protection must be renewed.



Details on corrosion protection can be found in the documentation *Information on operating fluids*.


Transporting the machine by truck

Machine preparation for transport by truck


For truck transport, the machine must be placed on wooden planks. The "Wooden planks, retaining plates, and screws" fastening set is included in the delivery condition of the machine.

- To do this, lift the machine slightly with a transport means approved for transporting the machine (see Chapter *General*) and support it to secure it.
- Remove the support feet and, if mounted, the mounting for the swivel plate of the steerable transport roller.
- Reinstall the transport supports/transport lugs.
- Place anti-slip mats (5) on the wooden planks (4) and fasten the wooden planks (4) to the machine using the retaining plates (1-3).

Illustrations show examples, right side view

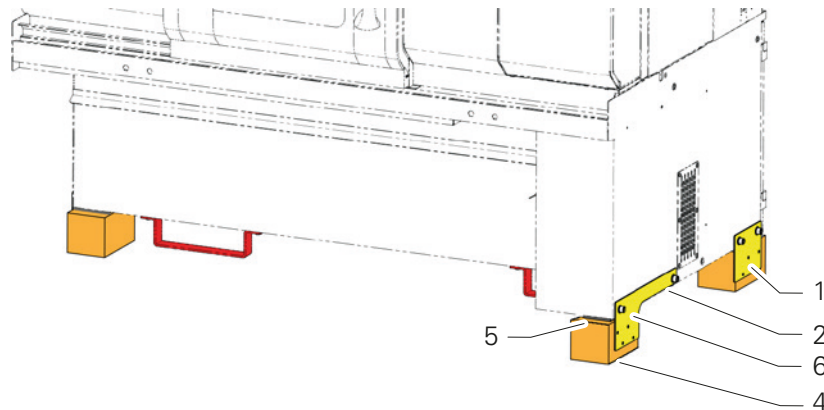


Left side view

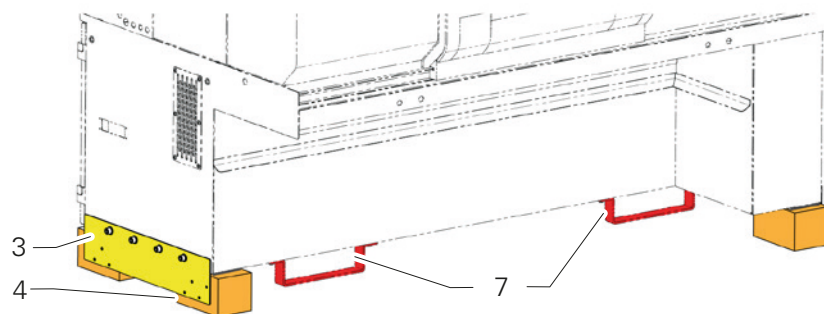


- 1-3 Retaining plate for wooden plank
- 4 4x wooden plank 120x120x200 mm
Alternatively: 2x wooden plank 120x120x1000 mm
(wooden planks fastened to the retaining plates with wood screws)
- 5 4x anti-slip mat (thickness 8, 9, or 10 mm), e.g., 100x100x8 mm
- 6 4x cylinder-head screw M12x20, 4762 with washers
- 7 Transport supports/transport lugs

Transporting the machine by truck

To avoid heavy impact during transport, the truck should have air suspension!

- 

Transport the machine with the control cabinet side on the left (in the direction of travel) (see illustration).
- 

The machine must be lashed diagonally to the truck loading platform using **approved straps (a)** in conjunction **with anti-slip mats (coefficient of friction 0.6μ)**.

Approved straps (a)

One-part strap with ratchet LC (Lashing Capacity)	Quantity	4
	daN	1500

Strap bias load


Hand force SHF	daN	approx. 50
----------------	-----	------------

Illustrations show examples of straps (Source: ESSKA.de GmbH)



Example of transporting on a truck loading platform

Example shown

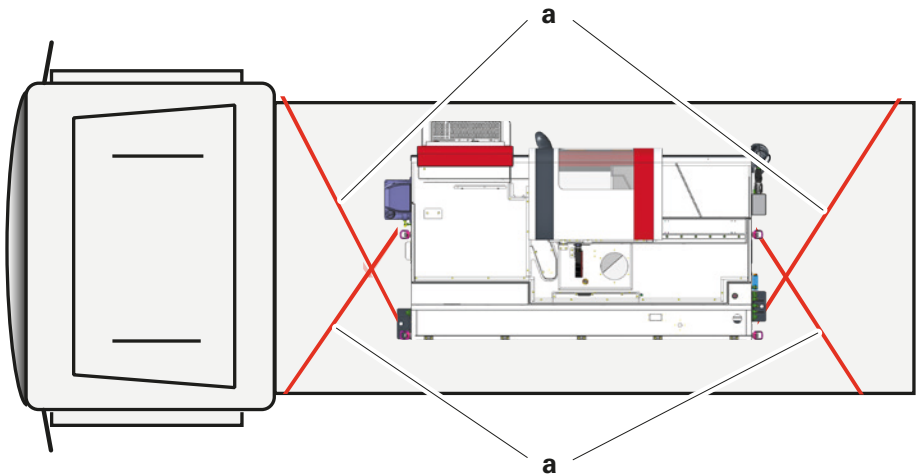


Loading guard

The load must be secured against slipping by the methods listed below.

Anti-slip mats

- Secure the load by placing anti-slip mats (9 mm thick) between the loading platform and the wooden planks of the machine.

Illustrations show examples

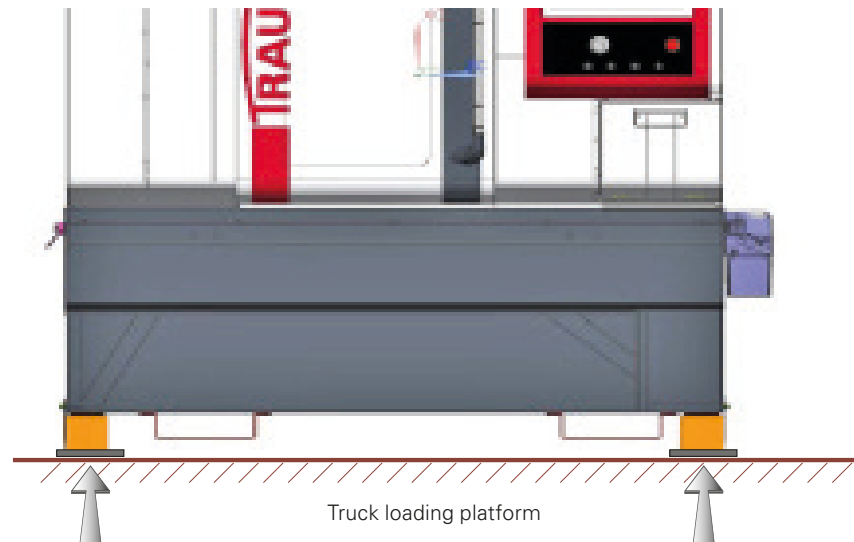


- Diagonal lashing**

The machine must be diagonally lashed to the loading platform with suitable straps (see "Example of transporting on a truck loading platform").

For this purpose, 4 rotatable load stands are to be screwed into the (M24) thread intended for them on the machine base.

Illustrations show examples

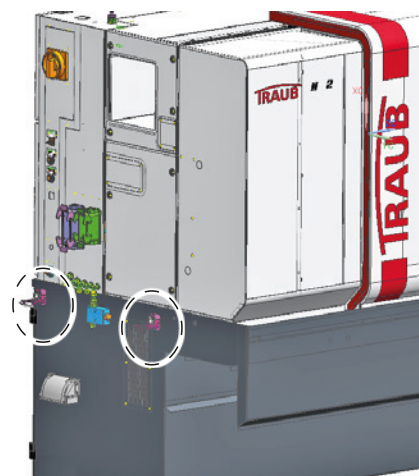

INDEX

INDEX-Werke GmbH & Co. KG
Hahn & Tessky

Plochinger Straße 92
D-73730 Esslingen

Fon +49 711 3191-0
Fax +49 711 3191-587

info@index-werke.de
www.index-werke.de